CARR-206

Wilson's Inheritance, (Frank Englar Farm, Emil White Farm)

Architectural Survey File

This is the architectural survey file for this MIHP record. The survey file is organized reverse-chronological (that is, with the latest material on top). It contains all MIHP inventory forms, National Register nomination forms, determinations of eligibility (DOE) forms, and accompanying documentation such as photographs and maps.

Users should be aware that additional undigitized material about this property may be found in on-site architectural reports, copies of HABS/HAER or other documentation, drawings, and the "vertical files" at the MHT Library in Crownsville. The vertical files may include newspaper clippings, field notes, draft versions of forms and architectural reports, photographs, maps, and drawings. Researchers who need a thorough understanding of this property should plan to visit the MHT Library as part of their research project; look at the MHT web site (mht.maryland.gov) for details about how to make an appointment.

All material is property of the Maryland Historical Trust.

Last Updated: 11-08-2012

MAGI # 0702062405

United States Department of the Interior Heritage Conservation and Recreation Service CARR-206

National Register of Historic Places Inventory—Nomination Form

See instruction: Type all entries	s in How to Complet —complete applicat	te National Regis ple sections	ter Forms				
1. Nam	e						
historic	Wilson's In	neritance (preferred)	1			
and/or common	Frank Engla	r Farm, Emil V	White Farm	n			
2. Loca	ation						
street & number		of Union Brid	dge Road	30	n/a	not for pub	lication
city, town	Union Bridge	e <u>X</u> vi	cinity of	congressional dis	trict	Sixth	
state	Maryland	code 24	county	Carrol1		code	013
3. Clas	sification						- 7
Category district X building(s) structure site object	Ownership public private both Public Acquisition in process being considere X not applica	Accessible yes: red yes: u	upied n progress le	Present Use agriculture commercial educational entertainmen governmen industrial military	ent	museur park private religiou scientif transpo	residence s ic
4. Own	er of Prop	erty					
name	Emil H. Whi	te				100	
street & number	4400 Green	Valley Road					
city, town	Union Bridg	e <u>n/a</u> vi	cinity of	s	tate	Maryland	21791
	ation of Le	-		on			
courthouse, regi	stry of deeds, etc.	arroll County	Courthous	se Annex			
street & number	5	5 North Court	Street				
	W	estminster			tate	Maryland	
6. Rep	resentatio	n in Exi	stina !		- I ale		
	and Historic Tru		Julia	04110,0			7.510
	ric Sites Invent		has this pro	perty been determin	ed eleg	ible? y	es X no
date 1978				federalX	state	county	loca
depository for s	urvey records	l State Circl	e				
city town	A	nnapolis		5	state	Maryland	21401

7. Desc	ription		CAI	RR-206
Condition excellent good fair	deteriorated ruins unexposed	Check one unaltered	Check one original site moved date	*10)
· ·		al (if known) phys	The second of th	
Number	of Resources		Number of previously listed	
Contrib	Nonc	ontributing buildings	National Register properties included in this nomination:	0
-	0 0 0	sites structures objects	Original and historic functions uses: agriculture, residence	and
	17 0	Total		

DESCRIPTION SUMMARY:

Wilson's Inheritance is a mid-nineteenth century farmstead that illustrates an affluent agricultural complex of central Maryland. The property retains numerous period outbuildings and the architectural character of the 1832-38 farmhouse presents a variation on the regional Pennsylvania farmhouse that indicates the prosperity of its original owner. This variation consists of an inset, double-tiered porch in the central two bays of the six-bay main facade. Other exterior features of the house, such as its L-shaped plan, stone foundation, common bond brickwork (Flemish bond on the main facade), gable roof, ornamentation, and its siting into a slope, are characteristic of farmhouse construction in Carroll and surrounding counties. However, the interior of the house displays more elaborate ornamentation in the mantelpieces, chair rails, door frames and other woodwork than is typically found in the regional farmhouses. The total farm complex, that includes a bank barn, blacksmith shop, washhouse, smokehouse, chicken houses, sheds and a privy, is relatively intact and represents a large and prosperous farming operation of the mid-nineteenth century.

CARR-206

United States Department of the Interior National Park Service

National Register of Historic Places Inventory—Nomination Form

Wilson's Inheritance
Continuation sheet Carroll County, Maryland

Item number

date entered

7

received

For NPS use only

Page

1

GENERAL DESCRIPTION:

The property is located on the north side of Route 75, approximately one mile east of Union Bridge Road (Main Street in Union Bridge). The house sits back from Route 75 but originally was located close to the old turnpike road that passed through this section of the country. The site is gently sloping and the house constructed so that there is a full basement story on the main facade. The main facade of the house faces south.

The L-shaped brick structure is two-stories on a stone foundation. The main facade is six-bays wide while the west facade which contains the ell is four bays. The brickwork on the main facade is laid in Flemish bond. The other facades are laid in common bond consisting of five rows of stretchers between single rows of headers. Other brickwork includes a narrow corbelled brick cornice and a string course that runs under the windows, stopping short of the corners. There are three rectangular brick chimneys with rectangular openings in the tops of the stacks: one in the north end, one in the east end, and one west of center in the south section. The basement and first floor windows have segmental arches; the second floor windows are capped with a row of headers.

The windows in the south facade have louvered shutters while elsewhere the shutters are paneled. The original fenestration was nine-over-six pane sash on the first story and six-over-six sash on the basement and second story. The bottom sash in these windows has been replaced with single pane sash. The gable ends of the main section have two four-pane windows.

United States Department of the Interior For NPS use en

National Park Service

National Register of Historic Places Inventory—Nomination Form

Continuation sheet Wilson's Inheritance Item number date antored

received

2.

CARR-206

(DESCRIPTION continued)

The six-bay main facade has an interesting arrangement with an inset, doubletiered porch in the central two bays. Occasionally in this region, a house of this style will be found, although frequently the inset porch is at one end of the main facade or in an asymmetrical arrangement instead of the central location as found at Wilson's Inheritance. The inset bays are fenestrated as described above except for an entrance in the east bay of the first and second stories and for the east and central bays of the basement: the second bay from the east has a four-pane window and the central section has two square windows covered with iron bars.

The inset porch has four, evenly-spaced Roman Doric columns with half columns on the ends that are attached to the walls of the house. The first story porch railing has square balusters; the second story has a panelled railing with protruding square blocks where the columns are attached. There is a central flight of brick steps to the first story of the porch, and three doors leading off the porch: one in the east bay, and one in both of the side walls. Each door has a flat-arch fanlight with triangular section of molding in the top corners. The fanlights over the east and west side entrances have a stencil pattern covering the glass, and the fanlight over the door in the east bay has blue glass without muntins. The door jambs have single panels and a panelled soffit, with reeded molding around the jambs and between the door and fanlight.

On the west elevation, the basement is a full-story and constructed of brick. A porch across the middle two bays of the first story forms a columned portico at basement level. The columns supporting the porch are Roman Doric, and the first story railing has plain square balusters. The central two bays have six-panel doors with glass center panels. On the first story, the north central bay has a glass-paned door with a four-light transom. The door in the south central bay has been made into a window with a panelled transom.

The gable end of the north facade is unfenestrated except for two gable windows flanking the interior-end chimney. The stone foundation steps up towards the west on this side. The outlines of a projecting bake oven were visible in the basement level above the foundation and the current owner had a beehive bake oven reconstructed in 1980.

The inner side of the ell has a one-story porch running along one-bay of the ell and two bays of the north facade of the main block. The porch appears to be an original feature of the house although it has recently been reconstructed. ell has a entrance under the porch and six-over-six sash windows in the other bays. The north facade of the main section has three bays on the first story and two bays on the second story. Each of these bays have windows except for an entrance in the central bay. Both of the entrances under the porch have plain jambs, stone sills and segmental arches. The east gable end of the main section has two four-pane windows in the gable.

CARR-206

United States Department of the Interior National Park Service

National Register of Historic Places Inventory—Nomination Form

Continuation sheet Wilson's Inheritance

Item number

Page 3

(DESCRIPTION continued)

The interior plan conforms to the exterior appearance of the house. The inset section of the main facade is laid out for two small rooms of which one is an entrance foyer with a stairway. Off each end of the inset section are large rectangular-shaped rooms--a parlor on the east side and a dining room on the west side. The ell contains a kitchen but appears to originally been partitioned into two rooms. Along with the main stairway, there are corner stairs in the dining room and ell kitchen. There are fireplaces in the parlor, dining room and a large hearth in the kitchen.

The first story kitchen has its original hand-cut oak floor. Now a kitchen, at one time it may have been divided into two rooms by a wall on the west side of the fireplace. On the north wall, the fireplace is flanked on the west by a cupboard and on the east by a storage closet and a corner staircase. The fireplace has a wooden beam above the rectangular opening, a plain surround, and a molded cornice under the shelf. The cupboard, closet, and staircase doors all have handmade butt hinges. The double-leaf cupboard doors with handmade knobs have two panels in the top and one in the bottom section. The storage closet has a beaded board-and-batten door and the six-panel staircase door has a handmade latch. The surbase and There are four doors in the room: two lead subbase of the baseboard are molded. into the rooms in the main block and two lead outside (one on the east wall and one on the west wall).

The door on the west enters the dining room next to that room's corner staircase, which is enclosed with beaded vertical-board walls. On the east wall is a fireplace flanked on the north by a glass-paned door to the central room and on the east by a door to the front inset porch. The fireplace is off-center in the chimney breast. It has deep molded cornice, a plain frieze, reeded-end blocks with triangular-shaped insets of horizontal reeding at the top and bottom, an architrave of three reeded bands; reeded Roman Doric quarter columns, and a square brick opening with a plain surround. The opening probably had some kind of facing, as there is a space between the mantelpiece and the brick. There is a plain baseboard and a chairrail with a rounded shelf, fillet and a beaded bottom.

The east central room is a narrow space with one window at each end. The north corner of its east wall has a six-panel door leading into the stairhall and the south corner has a flat-arch doorway. The molded trim around the arch is different from that in the rest of the house. The stairhall side of the arch also has trim that is different with beaded edges and a strip of reeding down the center. The anomalous trim and the projection of the staircase beyond the opening suggest the arch was added later.

United States Department of the Interior National Park Service

National Register of Historic Places Inventory—Nomination Form

CARR-206
For NPS use only
received
date anteres

Continuation sheet Wilson's Inheritance

Item number 7

Page 4

(DESCRIPTION continued)

The staircase hall doors lead to the back porch and to the front porch. Against the west wall is an open-well staircase with two flights and a landing. The open-string stairs have square balusters, a turned newel post, and scrolled ogee brackets. There is a door to the basement underneath the stairs in the rear.

The parlor contains an excellent example of a rural Victorian-style interior through a late nineteenth century remodeling that includes marbelized trim and grained woodwork. The fireplace is in the center of the east wall and is marbelized with a black U-shaped shelf, an ovolo cornice, stepped-bed molding, panelled-end blocks and frieze, (the latter is set in a black frame), black Roman Doric double columns on plain square bases, a marbelized surround with beaded trim, and a plaster opening. The molded trim on the door and windows is uniform with circular designs in the corner blocks. Both doors have grained panels, panelled jambs and soffits. The door to the hall has a grained transom panel. The subbase of the baseboard is bevelled out from the top section.

The plan of the second floor is similar to the first floor except that the main block has been divided into three rooms: one on the east side and two on the west. The stairs that descended from the east room into the kitchen have been blocked up, and the south room has been made into a bathroom. The window trim is the same as in the rest of the house, and there are plain baseboards. Ornamental features of the second floor include a six-panel door with painted graining, and a corner staircase railing with square balusters and a squared rail, four-pane transom with patterned glass in the door to the front porch, and Victorian-style trim in the east bedroom.

The east bedroom has the same dark trim with corner blocks as the room below it except that the window trim is simpler and has trapezoidal sills. The six-panel door is grained. The fireplace design is like the one on the first floor but has single columns; the frieze is deeper and projects over the opening; and the opening surround is a plain wide band.

The basement consists of one room in the north section and three rooms and a central hall in the south section. All interior walls are brick, and the exterior walls are brick and stone. The north room was probably the original kitchen. In the west corner of the north wall is a corner staircase, and the rest of the wall contained the fireplace. (The fireplace beam is fourteen feet long.) The west end of the fireplace which contains brickwork for the exterior bake oven retains the original iron door. There is a brick partition between this part of the fireplace and a storage space to the east. Wooden doors cover all the openings in the north wall. In the south wall is a panelled wainscot with a beaded shelf and doors in the center and east corner to the south section. The center door has six panels and leads to the southwest room.

OMB No 1024-0018 Exp. 10-31-84

CARR-206

For NPS usa entry

*A*** received

date entered

United States Department of the Interior National Park Service

National Register of Historic Places Inventory—Nomination Form

Wilson's Inheritance Continuation sheet

Item number

Page

(DESCRIPTION continued)

The southeast basement room appears to have served as a summer dining room in the original plan. There is a winder staircase in the northwest corner end a fireplace in the center of the east wall. The fireplace has a plain shelf, a molded cornice, a panelled frieze, fluted pilasters on plain block bases with diagonally reeded capitals, and a plain surround. The rest of the south section was not lived in. It consists of a central "hall" in the north with a small central room to the south and a furnace room to the east. The south room has a board-andbatten door with handmade nails and strap hinges. The furnace room has two brick cisterns in the northwest corner, with a hole in the brick pier next to it that is in line with a hole in the east wall--perhaps for a well-supplied water system.

The property contains several significant outbuildings, all of which contain original hardware. North of the house and placed diagonally to it is a two-story square smokehouse built into a slope. The brick is laid in common bond with six (sometimes seven) rows of stretchers to each row of headers. In the south end there is a stepped stone foundation and near the top are four ventilating holes in a diamond pattern. In the first story of the west side and in the second story of the east side are beaded board-and-batten doors with pegged frames and handmade strap hinges, nails, and latches. Inside, most of the floor joists have been replaced, but one full log joist remains.

North of the smokehouse is a two-story washhouse (two rooms long and one room deep) built over a spring. The building has a stone foundation, a gable roof and an interior-end chimney in the south end. The springhouse is built into the side of the hill, so the basement is at ground level and the main floor is entered from the top of the hill. Both exterior doors are board-and-batten with handmade latches and strap hinges. All windows are six-over-six pane each and the molding, including the interior and exterior window and door trim as well as the baseboards, is beaded. The basement level has two rooms opening on to a hall that runs the length of the east side. The south room has a large fireplace and the north room contains a water trough fed by the spring which indicates that this room probably functioned as a dairy. The main floor has a hall and parlor plan with a fireplace in the south room and beaded baseboards in both rooms.

North of the springhouse is a brick neccessary that has had extensive masonry reconstruction.

A stream separates the farmhouse and these outbuildings from the other farm building on the property. The stream has been dammed to provide a function to the farm operation. There is also a well in front of the washhouse which once was used to pump water to the barn.

MB No 1024-0018 Exp 10-31-84

CARR-206

Fer NPS use only

received

United States Department of the Interior National Park Service

National Register of Historic Places Inventory—Nomination Form

Continuation sheet Wilson's Inheritance

Item number

7

date antered

Page

(DESCRIPTION continued)

A group of buildings extend in a straight line west from the stream towards the barn. These include a frame shed with a pigeon house (also north of this shed are two chicken houses), a frame tool house with louvered windows, an extended frame wagon shed, and a brick blacksmith shop with an attached vertical board shed. The blacksmith shop is constructed of stretcher bond on a stone foundation. It has a board-and-batten door on the east wall and an interior-end chimney on the west wall.

South of this line of buildings is a frame bank barn that appears to have been rebuilt in the late 19th century. The rafters of the barn roof each contain two wood sections which indicate the possibility that the rafters of an earlier, smaller barn were reused in the construction of this barn. Also the ventilator trim uses a design that was popular during the late nineteenth century. The south gable end has a large gable ventilator window with a panel that contain the initials "FJE" (two Frank J. Englars owned the property from 1875 to 1974). The forebay faces southeast and has a large fenced barnyard. At the northeast corner of the barnyard is a carriage shed. At the southwest corner of the barn is the base of a brick silo and a frame sheed shed. Just west of the barn is a large wagon shed.

prehistoric 1400–1499 1500–1599 1600–1699 1700–1799 X 1800–1899 1900–	Areas of Significance—C archeology-prehistoric archeology-historic X agriculture X architecture art commerce communications		landscape architecture law literature military music philosophy politics/government	religion science sculpture social/ humanitarian theater transportation other (specify)
Specific dates	1837-38	Builder/Architect	Lewis Shueey	

Applicable Criteria: Applicable Exceptions: none Significance Evaluated:

SIGNIFICANCE SUMMARY:

Wilson's Inheritance presents a farmhouse and farmstead that embodies the distinctive characteristics of the early-to-mid nineteenth century in Piedmont Maryland. The farmhouse, built in 1837-38, represents several features of the typical Pennsylvania farmhouse in style and construction, but includes significant variations in its main facade design, floor plan and interior ornamentation that indicate the affluence of the original owner. From 1875 to 1974, the farm was owned by the Francis J. Englar and Francis J. Englar, Jr., families who were influential farmers and citizens of this region. The Englar family enlarged the barn and remodeled several rooms in the farmhouse to rural Victorian-style standards. Overall, the farm complex retains almost all of its nineteenth century buildings and the significant nineteenth century features of these structures, including an abundance of period hardware. The complex possesses infinite material for the study of agriculture and rural architecture in central Maryland.

HISTORY AND SUPPORT:

Samuel Wilson inherited a 415 acre parcel of land in 1792 which he called Wilson's Inheritance. It contains parts of Susan's Fancy and Round Spring which were land patents of Thomas Wilson dating from 1761 and 1753. Samuel Wilson had a mortgage to Henry Rial on about one-half of the property from 1819 to 1824. In 1824, Wilson sold 202 acres to William Currey for \$2300. Two years later, Currey sold the same property to Lewis Shueey for \$3000, and the increase in the purchase price suggests that there were some improvements made to the property during that time. However, the house as it presently stands was most likely constructed by Shueey in 1837-38, because the tax assessment valuation for those years jumps from \$7000 to \$15,000. Shueey sold the property in 1850 for \$10,000. It passed through several hands until 1875, when a 125 acre parcel was purchased by the Englar family who retained the property until 1974.

The architect of the farmhouse and farmstead illustrates a prosperous nineteenth century farm operation of Piedmont Maryland. The farmhouse uses a main facade design found only occasionally in this area - the central two-bay inset porch of the six-bay main facade presents a prestigious architectural variation on the typical five-bay Pennsylvania farmhouse style. This prosperity NPS Form 10-900-a

OMB No 1024-0018 Exp 10-31-84

United States Department of the Interior National Park Service

National Register of Historic Places Inventory—Nomination Form

For NPS are enly received date entered

Continuation sheet

Wilson's Inheritance

Item number

8

Page 7

(SIGNIFICANCE continued)

reflected through architecture was continued through the nineteenth century as shown in the rural Victorian style parlor of the house with its marbelized mantel and grained woodwork. A similar impression is given in the bank barn which was enlarged and ornamented by the Englars during the late nineteenth century.

The presentation of the outbuildings and their retention of period hardware are also significant features of the farm complex. These building possess many features that provide evidence of the daily life of residents in this agricultural region. Immediately behind the house is a two-story brick smokehouse, a two-story brick washhouse built atop a spring, and a square brick privy. West of this grouping is a straight line of farm buildings and sheds including a tool shed and a blacksmith shop. Also, grouped around the bank barn is a wagon shed, sheep shed, carriage shed and base of a brick silo. Many of the doors to these sheds contain wrought strap hinges, wrought thumb latches, and other wrought hardware which was probably made in the blacksmith shop on the farm.

The Englar family was typical of a large segment of Carroll County's first settlers, being part of the group that left the Swiss-German Palatinate region in the early eighteenth century, sailed to Philadelphia, and then moved west and south settling Lancaster and York counties in Pennsylvania as well as sections of central Maryland and the Valley of Virginia. The first Englar, Philip, to settle in Maryland moved from Chester County, Pennsylvania, to the Uniontown area (presently Carroll County) in 1764. His decendants were prominent in the farming and agricultural-related industries throughout this section of the county. The Englar family was primarily responsible for the development of Linwood (a National Register Historic District) as a railroad depot and village. Linwood is located one mile east of Wilson's Inheritance and the five Englar houses there date from 1866 to 1900, the same period when Francis J. Englar moved to Wilson's Inheritance.

Francis J. Englar was a fifth generation Englar in Carroll County (Philip-David-Joseph-William-Francis J.). He is listed as a patron in the 1877 Atlas of Carroll County as a farmer and dairyman. His farm reflects his prosperity from his occupation and his interests in maintaining an effecient and up-to-date farming operation. Francis J. Englar was born February 5, 1853 and died in October 1921. His farm passed to his son, Francis J. Englar, Jr., who continued the farm and dairy operations until his death in 1974.

OMB No. 1024-0018 Exp. 10-31-84

CARR-206

For NPS use only

received

9993

date entered

United States Department of the Interior National Park Service

National Register of Historic Places Inventory—Nomination Form

Wilson's Inheritance Continuation sheet Carroll County, Maryland

Item number 9 and 10

Page

8

MAJOR BIBLIOGRAPHICAL REFERENCES:

Barnes, Vivian Englar. History of the Englar Family. Taneytown, MD: The Carroll Record, 1929.

1877 Atlas of Carroll County.

Linwood Historic District National Register Nomination form.

Land Records of Carroll County.

Interviews with current owner, Emil H. White.


9. Major Bibliog. aphical References

CARR-206

See Continuation Sheet No. 8

10. Ged	ographic	al Data				
Quadrangle name	nated property app Union Bridge	proximately 21 e, Maryland	acres	Ska o	Quadrangle scale	1:24000
UMT References						
Zone Eastin	ng North	ing	B L	ne Easting	Northi	ng
	1	1111	미니	1 44		لببا
			H L			
Verbal boundar	y description and	d justification				
	inuation Sheet					
List all states a	and counties for p	properties overla	pping state o	r county boo	ındaries	
state n/a		code	county			ode
state		code	county	1	c	ode
11. For	m Prepa	red Bv				
name/title	Natalie Shi	vers/Joe Getty				
organization		storical Trust		date .T:	anuary 1984	
street & number	21 State Cir			telephone	269-2438	
				toropriorio	209-2436	***************************************
elty or town	Annapolis			state	Maryland	21401
12. Sta	te Histoi	ic Prese	rvatio	n Offic	er Certi	fication
The evaluated sig	nificance of this pro	perty within the st	ate is:			
	national	state X	local			
665), I hereby non according to the o	ninate this property	servation Officer for inclusion in the res set forth by the	National Regis	ster and certif	y that it has been	evaluated
State Historic Pre	servation Officer Si	gnature				
itle	STATE HISTOR	IC PRESERVATION	ON OFFICER		date	
	tify that this proper	ty is included in the			date	
Keeper of the N	ational Register	i dis	4.754		date	
Chief of Registra	ation •	ar of the same	CONTRACTOR OF THE PARTY OF THE	C CHILD	Santa January	ed water

CARR - 206 Wilson's Inheritance, 1837-Union Bridge vic. annum minne MIIII

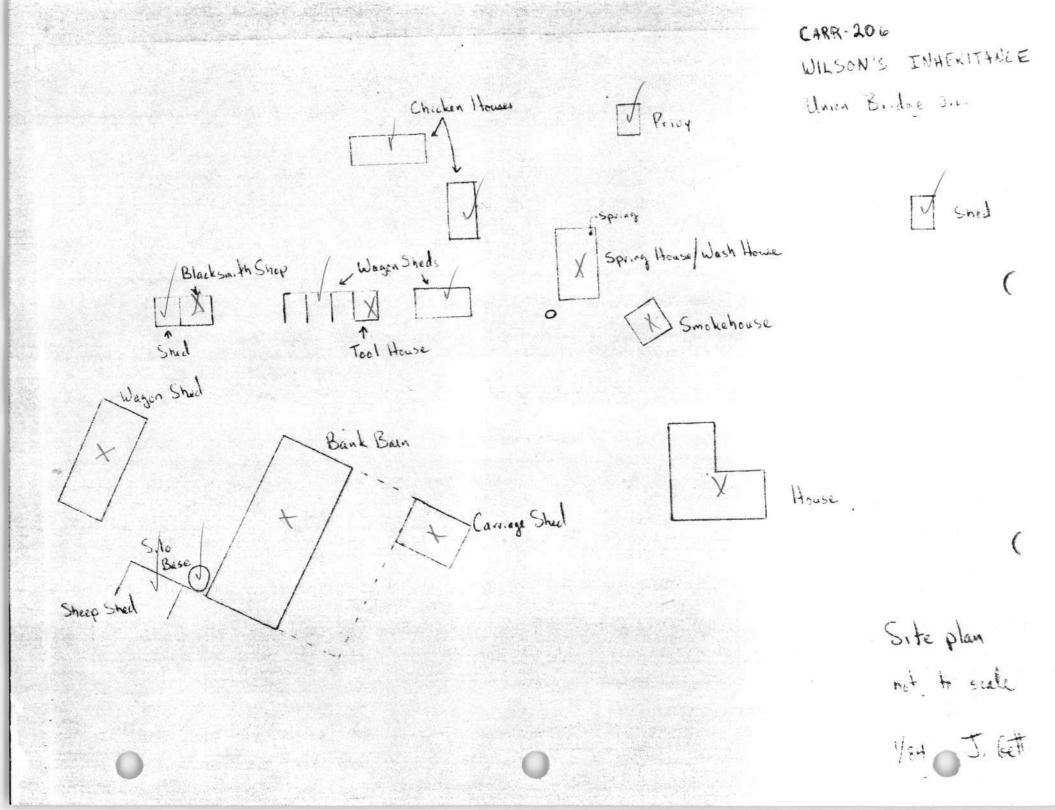

Maryland Historical Trust State Historic Sites Inventory Form

Magi No.

DOE __yes __no

1. Nam	le (indicate pre	eferred name)	.vanor eserx	3 37 88	Sinswells anol	STREET, STREET
historic	subbut notal of CV s	Soci to able timon	and.	iljal si Lynsk ki	This some	
and/or common	Emil White House	se in briefforch a.	und bagada-1s	y znda-	owl shir.	
2. Loca	ation	its south and, a se	or pautoi "pu	in sixo	donastil-south	
street & number	North side of Md. I	Rte. 75	vistble seam	on hitis	not for publicatio	n
city, town	Union Bridge	_x_ vicinity of	congressional d	listrict		M
state	Maryland	county	Carroll Carroll	abla Je	south, and we	
3. Clas	sification	lad belledion vers	n n el scont	.erebs	and one of her	
Category district _X building(s) structure site object	Ownership publicX private both Public Acquisition in process being consideredX not applicable	X occupied unoccupied work in progress Accessible X yes: restricted yes: unrestricted no	Present Use agricultur commerc educatior entertainr governme industrial military	ial nal ment ent	museum park X private reside religious scientific transportation other:	
4. Owr	er of Prope	rty (give names an	nd mailing ad	dresses	of <u>all</u> owners)
name	Emil White	two-story porch.	containing a	facade	south (front)	
street & number	Rt 1, Box 381	d brouge second b	teleph	none no.	: 775-2981	
city, town	Union Bridge	state	and zip code	Maryla	and 21791	
5. Loca	ation of Lega	al Description	n I fine and	or bails	that are ster	
courthouse, regi	istry of deeds, etc. CARROI	LL COUNTY COURTHOUSE	oeks where th	dare bl.	liber	
street & number	first floor porch;	hrick steps to the	ed filgli of		folio	
city, town	Westminster	a flattened arch	and rook that I	state	Maryland	
6. Rep	resentation	in Existing	Historical	Surve	ys a dasw one	
title	maj edi bovure goto	it, with reeded mol	lioe balibasi Mgilasi bas	e buta he door	single panels and between t	
date	L. oktober	•	federal .	state	county	loca
aepository for s	urvey records					
city, town				state		

7. Description

Survey No. CARR-206

Condition excellent	deteriorated	Check one unaltered	Check one X original site	
X good	ruins	X altered	moved date of move	
fair	unexposed			

Prepare both a summary paragraph and a general description of the resource and its various elements as it exists today.

This house is located on the north side of Route 75 in Union Bridge, Carroll County, Maryland.

This two-story el-shaped house is brick with a gable roof and a stone foundation. The el consists of two one-room deep wings: a north section on a north-south axis and, joined to its south end, a south section on an east-west axis. The west walls of the sections are flush, forming a single continuous wall with no visible seam. The four-bay west side and the six-bay south side form the outside of the el.

The house is set on a hill, and the foundation is stepped on the north, south, and west sides to follow the incline. The south face is laid in flemish bond; all others are laid in common bond with five rows of stretchers and one of headers. There is a narrow corbelled brick cornice and a string course that runs only under the windows, stopping short of the corners. There are three rectangular brick chimneys with rectangular openings in the tops of the stacks: one in the north end, one in the east end, and one west of center in the south section. The basement and first floor windows have segmental arches; the second floor windows are capped with a row of headers. The windows on the south side have louvered three-panelled shutters. The bottom six-light sashes of most windows have been replaced by single light sashes. The first story has 9/1 sash, the second story has 6/1 sash, and the gable windows have four lights.

The south wing is U-shaped with a recessed central section in the south (front) facade containing a two-story porch. There are two bays each in the side and central sections, with two 6/1 sash windows in the west bays of the basement, a four-light window in the second bay from the east, and square openings with iron bars in the central section. The segmental arch over the second bay from the west has been rebuilt. Both porches have four evenly-spaced Roman Doric columns, including the half columns on the ends that are attached to the walls of the house. The first floor porch railing has square balusters; the second floor porch has a panelled railing with protruding square blocks where the columns are attached.

There is a central flight of brick steps to the first floor porch, and three doors leading off the porch, one in the east bay and one in both of the side walls. Each door has a flattened arch fanlight with triangular sections of wavy molding in the top corners. The fanlight over the east and west side doors have patterned colored glass, and the fanlight over the door in the east bay has blue glass and no mullions. The door jambs have single panels and a panelled soffit, with reeded molding around the jambs and between the door and fanlight.

1400 1500 — 1600 — 1700	istoric)-1499)-1599)-1699)-1799)-1899	are X ag X are are are co	of Significance cheology-prehistoric riculture chitecture mmerce mmunications	oric - - -	coi coi ecc edu eng exp	nd justification in the servation of the servation in the	y plannii on g	ng _ _ Bi <u>s</u>	law litera milit mus phile	ature ary	chitectu	scie scul scul soci hum thea	nce pture al/ anitarian
Specific	dates		192	В	uilde	r/Archit	ect		7 1				A.
check:	aı	nd/or	Criteria:	_	В	c c	D D	E	F	G		germasi	51.2
			ignificance:				_		-		lulub lulub		

Prepare both a summary paragraph of significance and a general statement of history and support.

The Emil White House is a large brick house with an unusual floor plan and interior detailing representative of several successive periods. Handwrought hardware survives in the north wing, while Greek Revival mantels in the south wing and Victorian woodwork represent a variety of later 19th century decorative traditions. Of particular interest is the marbelized finish and dark-stained trim found in the Victorian rooms. Also of interest is the complex of early outbuildings associated with the house. These include a two story brick smokehouse, a springhouse built into the side of the hill, a brick outhouse, and a square brick blacksmith shop.

10. Ged	graphical Data	a		=	
Quadrangle name	ated property do NOT complete UTM re			Quadrang	le scale
A L L L Zone Easting	لتبليلنا لتبل	B	Easting	لبلبا	Northing
		D			
X	y description and justification		r county ho		
state	code	county	. county so	undanes	code
state	code	county			code
11. For	m Prepared By Joe Getty, Historic S		3		
organization	Maryland Historical T	rust	date	1976	
treet & number	21 State Circle		telephone	(301)	269-2438
city or town	Annapolis		state		nd 21401
The state of the s	AND STREET			- 11.	ALL TAIL TO

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to:

Maryland Historical Trust

Shaw House

21 State Circle

Annapolis, Maryland 21401

(301) 269-2438

Description (continued)

North of the smokehouse is the springhouse which may have been used as living quarters at one time. Two rooms long and one room deep, the building has a stone foundation, a gable roof, and an interior chimney in the south end. The apringhouse is built into the side of the hill, so the basement is at ground level and the main floor is entered from the top of the hill. Box exterior doors are board-and-batten with handmade latches and strap hinges. All windows have 6/6 sash; all molding, including the interior and exterior window and door trim and the baseboards, is beaded.

The south foundation wall steps down towards the west. There is a roundarched door in the basement east bay and two windows in the first story. The first floor door is in the east side, in the second bay from the south. The door is flanked by one window on the south and two windows on the north.

The north end has a window in the center bay in the first story and one gable window. In the east basement bay is an opening with wooden slats.

The west side has one window in the first story north bay and openings in both basement bays.

Inside the basement level a hall runs along the east side and two rooms opening off to the west. The south room has a large fireplace in the south wall. In the north wall is a door to the north room, which has water troughs in the floor.

The main floor is a traditional hall-and-parlor plan. The hall is the south room and has a fireplace in the south wall. In the southwest corner are steps to the attic. There is a beaded baseboard here and in the north room. In the north wall is a newer door to the north room. This room has a beaded coatrail between the windows in the north and west walls.

In the attic the rafters are hand-hewn and pegged together at the top.

North of the springhouse is a brick outhouse with a pegged door frame.

To the west of this complex is a blacksmith's shop. It is a square brick building laid in all-stretcher bond with a belt course of headers and a stone foundation. The pointed rafter-ends project over the walls. The south and north sides both contain a central two-light sash window, capped by a row of headers. The board-and-batten door is in the east wall. In the west end is an interior chimney.

7. Description (continued)

In the west elevation, there is no stone foundation since the basement is above ground. A porch across the middle two bays of the first floor forms a columned portico at basement level. The columns supporting the porch are Roman Doric, and the first floor railing has plain square balusters. The basement middle bays are both six-panel doors with glass center panels. In the first story, the north middle bay has a glass-paned door with a four-light transom. The door in the south middle bay has been made into a window with a panelled transom.

The north end of the north section is blank except for two gable windows flanking the interior end chimney. The stone foundation steps up towards the west on this side. The outlines of two beehive ovens are visible in the basement level above the foundation.

The two-bay east side of the north section shares a one-story porch with the north side of the south section. Although this porch was built recently, there was probably always one here, as the door opening appears to be original. On the east side, the porch covers the south bay, which has a door like the ones in the basement west side. The windows in the second floor and basement have their original 6/6 sash. The north bays in the first and second stories are not aligned.

The north side of the south section has three bays in the first story, and two in the second. The porch covers the west and central bay, which has a door like the other porch door. Both doors have plain jambs, stone sills, and segmental arches - the arch over the door in the north section is shorter and cruder.

The east end of the south section is blank except for two gable windows flanking the chimney. The stone foundation steps down towards the south, and there is a square opening in the basement north bay covered with a pierced iron plate on hinges.

The interior plan of the first floor is unusual and slightly awkward. The north section contains one room with a fireplace and winder staircase in the northeast corner. The U-shaped south section consists of one room in each side and two rooms in the center part, of which the east is the stairhall. Both side rooms have fireplaces, and there is a winder staircase in the northwest corner of the west room.

The room in the north section has its original hand-cut oak floor. Now a kitchen, at one time it may have been divided into two rooms by a wall on the west side of the fireplace. In the north wall, the fireplace is flanked on the west by a cupboard and, on the east, by a storage closet and a corner staircase. The fireplace has a wooden beam above the rectangular opening, a plain surround, and a molded cornice under the shelf. The cupboard, closet, and staircase doors all have handmade butt hinges. The double-leaf cupboard doors with handmade knobs have two panels in the top and one in the bottom section. The storage closet has a beaded board-and-batten door and the six-panel staircase door has a handmade latch. The surbase and subbase of the baseboard are molded. In the

7. Description (continued)

west wall, the door to the porch is like the door in the east wall. There are two doors to the south section in the south wall.

The door on the west enters the southwest room next to the corner staircase, which is enclosed with beaded vertical board walls. In the east wall is a fireplace flanked on the north by a glass-paned door to the next room and, on the east, by a door to the front porch. The fireplace is off-center in the chimney breast. It has a deep molded cornice, a plain frieze, reeded end blocks with triangular-shaped insets of horizontal reeding at the top and bottom, an architrave of three reeded bands, reeded Roman Doric quarter columns, and a square brick opening with a plain surround. The opening probably had some kind of facing, as there is a space between the mantelpiece and the brick. There is a plain baseboard and a chairrail with a rounded shelf and fillet and a beaded bottom.

To the east is a narrow room with one window at each end. In the north corner of the east wall is a six-panel door leading into the stairhall, and in the south corner is a rectangular arch. The molded trim around the arch is different from that in the rest of the house; on the stairhall side the trim is also different with beaded edges and a strip of reeding down the center. The anomalous trim and the projection of the staircase beyond the opening suggest the arch was added later. In the staircase hall, there are doors in both ends: one to the back porch, and one to the front porch. Against the west wall is an open-well staircase with two flights and a landing. The open-string stairs have square balusters, a turned newel post, and scrolled ogee brackets. There is a door to the basement underneath the stairs in the rear.

The east room has been Victorianized with fake marbelling and dark-stained trim. In the south corner of the west wall, a door opens to the front porch. The fireplace is in the center of the east wall. It has a black, U-shaped shelf, an ovolo cornice, stepped bed molding, marbelized, panelled end blocks and frieze (the latter is set in a black frame), black Roman Doric double columns on plain square bases, a marbelized surround with beaded trim, and a plaster opening. The molded trim is the same on the door and windows with circular designs in the corner blocks. Both doors have marbelized panels, panelled jambs and soffits. The door to the ahll has a marbelized fake transom. The subbase of the baseboard is bevelled out from the top section.

Except for the north section, the plan of the second floor is similar to the first floor. The north section has been divided into three rooms: one on the east side and two on the west. The stairs that descended from the east room into the kitchen have been blocked up, and the south room has been made into a bathroom. The window trim is the same as in the rest of the house, and there are plain baseboards. In the south wall of the east room is a doorway into the west room of the south section.

In this room, the fireplace in the east wall has been blocked up, and on its north side is a six-panel door with painted graining. At the top of the corner staircase is a railing with square balusters and a square rail. There is a plain baseboard, and the window trim is the same, except with trapezoidal sills.

7. Description (continued)

The windows in the west center room have narrow molded trim and a plain baseboard. There is a door to the stairhall in the south corner of the east wall.

In the south wall of the stairhall is a door to the porch, similar to the doors to the back porch. It has a four-light transom with the same patterned glass that is in the door in the west side of the front porch. The attic stairs are against the west wall and have a four-panel door.


The east room has the same dark trim with corner blocks as the room below it, except the window trim is simpler and has trapezoidal sills. The six-panel door has fake graining. The fireplace is shaped like the one below it, but there are single columns, the frieze is deeper and projects over the opening, and the opening surround is a plain wide band.

The basement consists of one room in the north section and three rooms and a central hall in the south section. All interior walls are brick, and the exterior walls are brick and stone. The north room was probably the original kitchen. In the west corner of the north wall is a corner winder staircase, and the rest of the wall used to contain the fireplace. The fireplace beam is fourteen feet long. The west end of the fireplace is still intact with the bread oven covered by an iron door on the back. There is a brick partition between this and the storage space to the east with a bricked-up oven in the back. Wooden doors cover all the openings in the north wall. In the south wall is a panelled wainscot with a beaded shelf and doors in the center and east corner to the south section. The center door has six panels and leads to the southwest room.

This room was used as a living room at some point. There is a winder staircase in the northwest corner and a fireplace in the center of the east wall. The fireplace has a plain shelf, a molded cornice, a panelled frieze with stepped molding, fluted pilasters on plain block bases with diagonally-reeded capitals, and a plain surround.


The rest of the south section was not lived in. It consists of a central "hall" to the north with a small central room to the south and a furnace room to the east. The south room has a board-and-batten with handmade nails and strap hinges. The furnace room has two brick vats in the northwest corner, with a hole in the east wall - perhaps for a rainspout.


There are numerous outbuildings, at least four of which are brick and probably older than the house. North of the house and placed diagonally is a two-story square smokehouse. The brick is laid in Flemish bond with six (sometimes seven) rows of stretchers and one of headers. In the south end there is a stepped stone foundation and near the top are four ventilating holes in a diamond pattern. In the first story of the west side and in the second story of the east side are beaded board-and-batten doors with pegged frames and handmade strap hinges, nails, and latches. Inside, most of the floor joists have been replaced, but one full log joist remains.

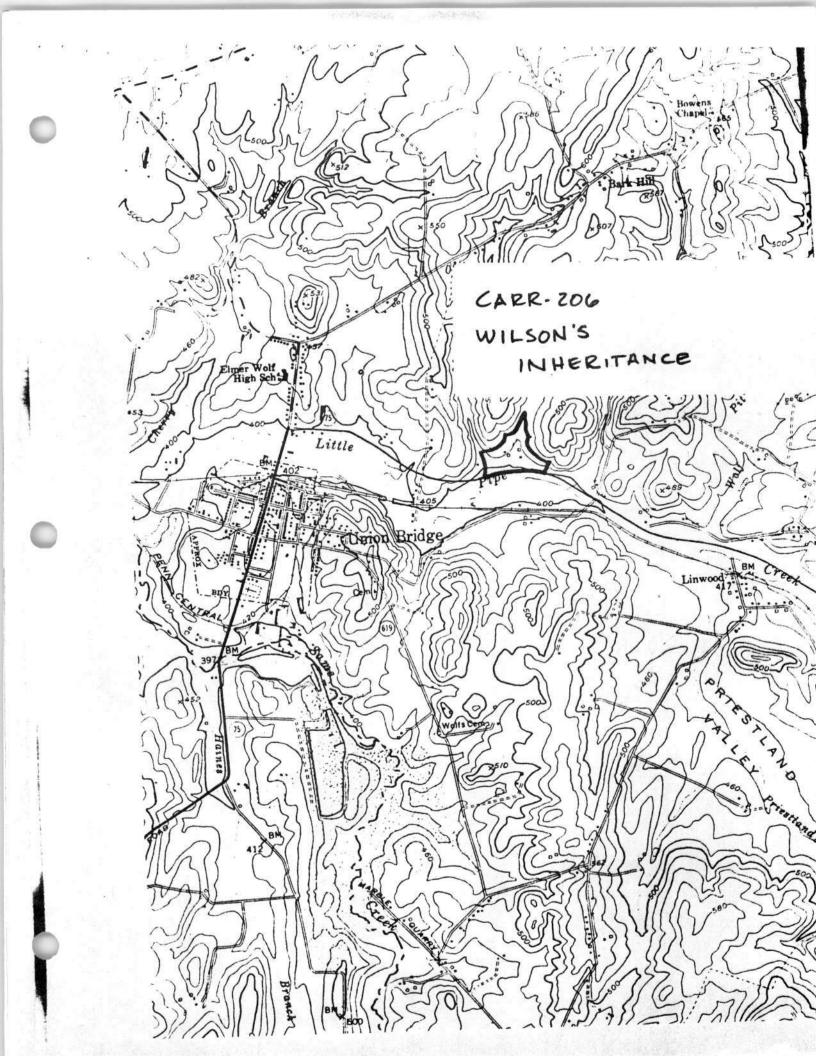



CARR-206

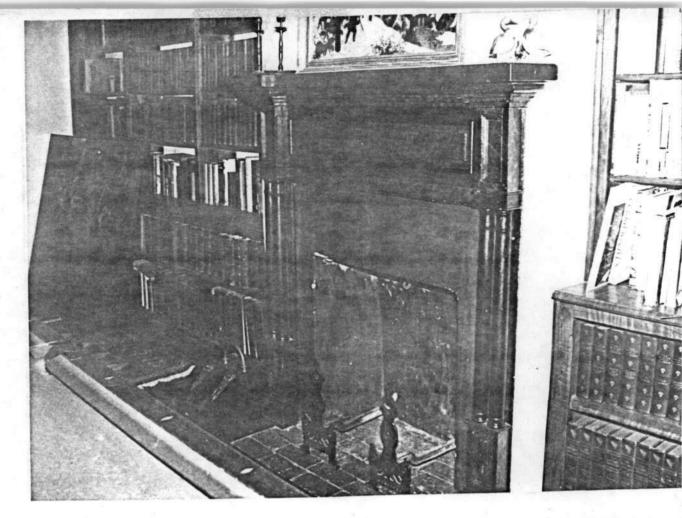

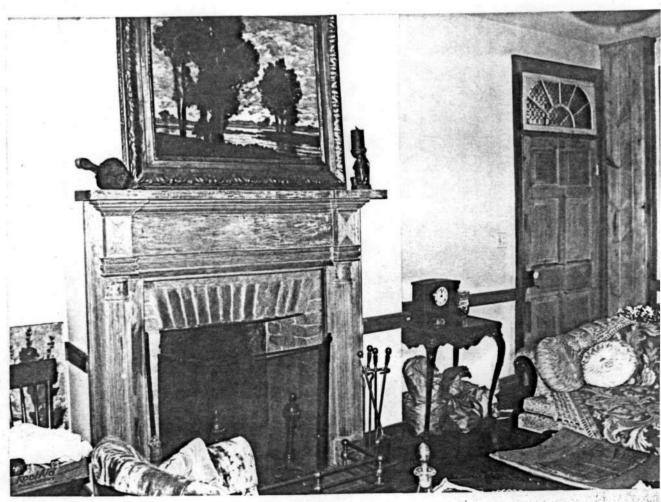

CARR-206

CARR-206 Wilson's Inheritance 4400 Green Valley Road (MD 75), Union Bridge Jennifer K. Cosham, 25 April 2006



South façade



South facade

CARR-206 Wilson's Inheritance 4400 Green Valley Road (MD 75), Union Bridge Jennifer K. Cosham, 25 April 2006



Southwest elevation



West facade

CARR-206 Wilson's Inheritance 4400 Green Valley Road (MD 75), Union Bridge Jennifer K. Cosham, 25 April 2006



Southeast elevation



Washhouses northwest of house, facing north



CARR- 206 Wilson's Inheritance Union Bridge vicinity

January 1984 J. Getty

south and west facades



CARR - 206

Wilson's Inheritance

Union Bridge siciality

January 1984

J. Getty

south and eat facades



(ARR-206 Wilson's Inheritance Union Bridge sicinity

January 1984

J. betty

west and north Facades



CARR- 206 Wilson's Inheritance Unim Bridge vicinity

January 1984 J. Getty

east and north facades



Wilson's Inheritance

Union Bridge vicinity

January 1984

J. betty

south facade, inset porch



CARR - 206 Wilson's Inheritance Unim Budge sicinity

January

J. Letty

paneled shutter, First story, north Facade



CARR-206 Wilson's Inheritance Union Bridge vicinity

January 1984

J. Getty

brickwork and window detail south Facade, basement level



CARR-206 Wilson's Inheritance Union Bridge vic.

January 1984 J. Letty

detail - entrance to west room off inset porch, south facade



(ARR-206 Wilson's Inheritance Union Bridge vicinity

January 1984

J. Getty

paneled shatter, basement level, west facade



Wilson's Inheritance

Union Budge vicinity

January 1984

J. Getty

wrought cellar window quate, east Facade



WILSON'S INHERITANCE

1/84 J. Getty

Rt. 75 Ulmin Bridge

Parlo: - towards mais entrance, south wall



Rt. 75 Umin Budge

Dining Room Mantel - Detail

WILSON'S INHERITANCE

Mer J. Getty



WILSON'S TNAFRITABLE

Rt 75 Chin Budge

During Room - east wall, showing exterior entrance

Ver J. betty



WILSONS INHERITANCE

Rt. 75 Unim Bridge

Dining Room - towards all, worth wall

Vining Room Towards ell, wath wa

1/84 J. betty



WILSON'S INHERITANCE

Rt. 75 Union Budge

Parlor Montelpicce - Detail

1/84 J. Getty



WILSON'S INHERITANCE

Rt. 75 Umin Budge

Parlos Mantel

1/84 J. Gett,



(ARR. 206 WILSON'S INHERITANCE

Rt. 75 Umin Burdge

Kitchi - Mantal detail

1/84 Joethy



WILSON'S TNAERITANCE

Rt 25 Unim Budge

Kitchen - North wall

1/84 J. Getty



J. Getty

WILSON'S INHERITANLE

Rt. 75 Ulmin Pridge


Stair Hall- Stair Ends



CARR. 206
WILSON'S INHERITANCE
Rt. 75 Union Bridge

Stair Hall - Doorway Woodwork

1/84 J. betty

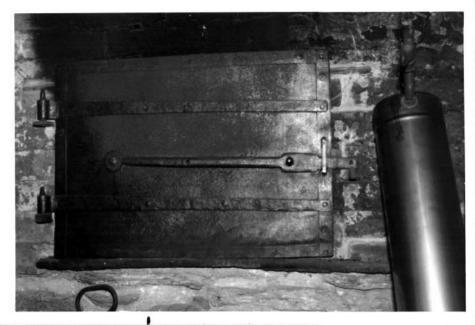

CARR - 206 WILSON'S INHERITANCE Rt 75 Unin Bridge Baumt Kitchen- Bake Over Dear 1/84 J. Letty



CARR-206 Wilson's Inheritance



(ARR-206 Wilson's Inheritance Union Bridge sic.

Jan- 1984

J. betty

Bank bain - north and east facades



(ARR- 206

Ver Jiletty

Rt. 75 Umin Bridge

WILSON'S INHERITANCE

Baserert Kitcher - Shelf Mountal




CARR. 206 Wilson's Inheritance Union Bridge vic.

January 1984

J. Getty

Smokehouse door - oast facade

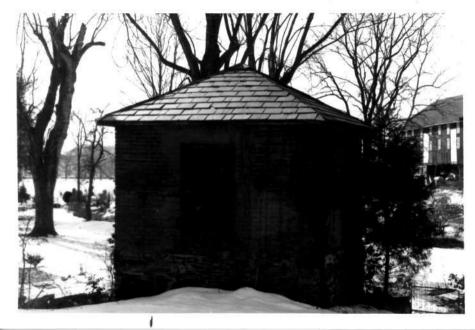


CARR-206 Wilson's Inheritance Union Buidge vicinity

January 1984

J. Getty

Smokehouse - north and east facades

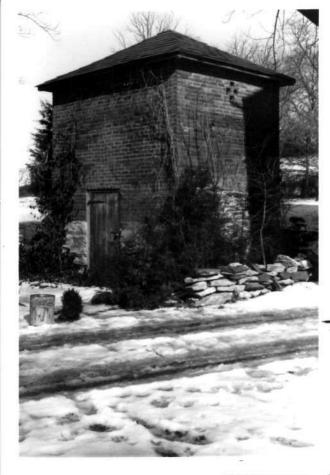

CARR-206 Wilson's Inheritance Union Bridge sic.

January 1984 J. Getty

Snokehouse - south and west facades



CARR- 206 Wilson's Inheritance Union Bridge Sic.

January 1984

J. Letty

Suchehouse decr - west facacle



CARR - 206 Wilson's Inheritance Union Bridge vic.

Jan. 1984

J. Getty

Washhouse door - south facade




CARR-206 Wilson's Inheritance Union Bridge vic.

Jan. 1984

J. Getty

Privy - south and east facades

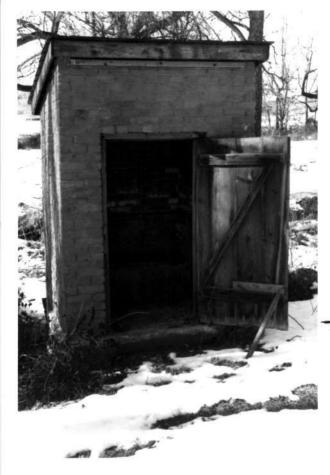

CARR-206 Wilson's Inhuitance

Unin Budge oic.

Jan. 1984

J. Getty

Prisy - detail - east facade



CARR - 206 Wilson's Inheritange Union Bridge sic.

Jan. 1484

Jan. 1986 J. Getty

Stream and Chicken Houses



(ARR - 206 Wilson's Inheritance Union Buidge vic.

Jan. 1984 J. betty

Washhouse - east and north facades



CARR - 206 Wilson's Inheritance Union Bridge vicinity

Jan. 1984

J. betty

Washhouse - south and west facales



CARR-206 Wilson's Inheritance Union Bridge sic.

Jan 1984 J. Getty

Carriage Shed - east and south facades



(ARR - 206 Wilson's Inheritance Union Bridge sic

Jan. 1984

J. Getty

Wagon Shed - east and south facales



CARR-206 Wilson's Inheritance Union Bridge vic.

Jan. 1184

J. Getty

Row of Catbuildings



(ARR- 206 Wilson's Inheritance Unim Bridge vic. Jan- 1964 J. bitty Shed attached to Blacksmith Shop - scatt & vect facales



CARR- 206 W. Ison's Inheritance Union Bridge sic.

Jan 1984

J. betty

Blacksmith Shop - east and south facules